

Cyclic Fatigue Durability of uncoated and EBC coated 3D SiC/SiC Composites under thermal gradient conditions at 2700F in air


Craig Smith, Bryan Harder, Dongming Zhu
NASA Glenn Research Center, Cleveland, OH

Ramakrishna Bhatt, Sreeramesh Kalluri
Ohio Aerospace Institute, Cleveland, OH

This work was funded by the Transformational Tools and Technologies (TTT) project at NASA Glenn

Material

- SiC/SiC CMC
 - 3D angle interlock woven Sylramic-iBN fibers
 - Hybrid CVI/PIP Matrix
- Silicon-Hafnia bond coat
- Rare Earth Silicate EBC deposited by Electron Beam Physical Vapor Deposition (EBPVD)

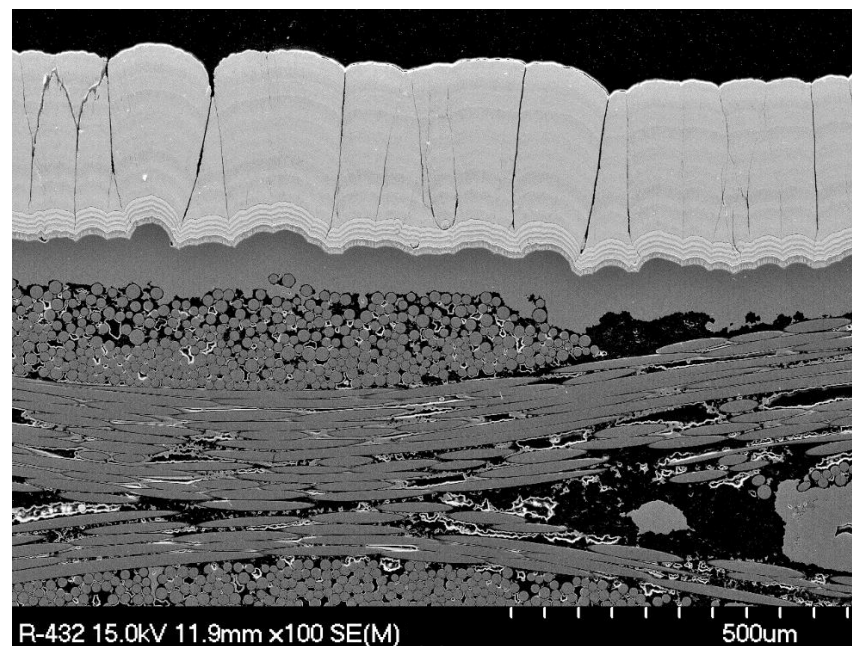


EBC

HfO₂-Si Bond Coat

SiC/SiC CMC

Objective

- Explore the durability of CMC/EBC system in air
 - Future tests will be done in steam
- Isothermal and through-thickness thermal gradient tests were conducted
 - Thermal gradients are representative of the conditions within a cooled CMC component
 - Isothermal tests provide uniform baseline properties
- What we want to determine
 - What is the failure mechanism?
 - Will the EBC protect from oxygen diffusion?

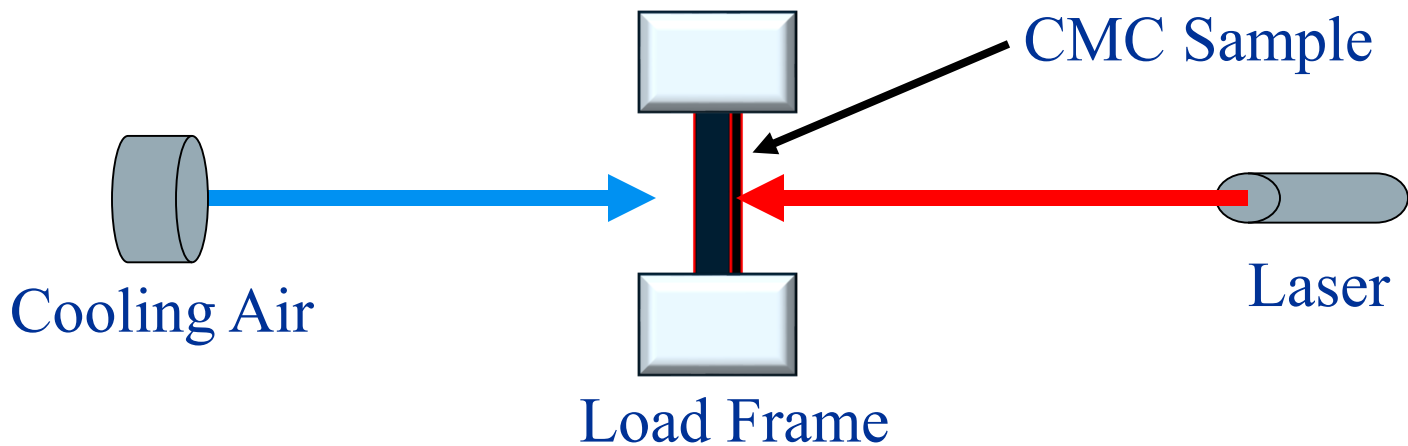


Fatigue Testing of CMCs under Thermal Gradient Conditions

Laser Test Rig

- Laser Heating (4000 W) on Front (0.8 inch spot size)
- Backside Air Cooling
- Surface Temperature Measured with Pyrometers and/or IR Camera
- Surface Temperatures up to 3000 °F (Material Dependent)
- Thermal Fatigue and Combined Thermal Gradient and Axial Fatigue



- Uncoated SiC/SiC Composites
- EBC Coated SiC/SiC Composites

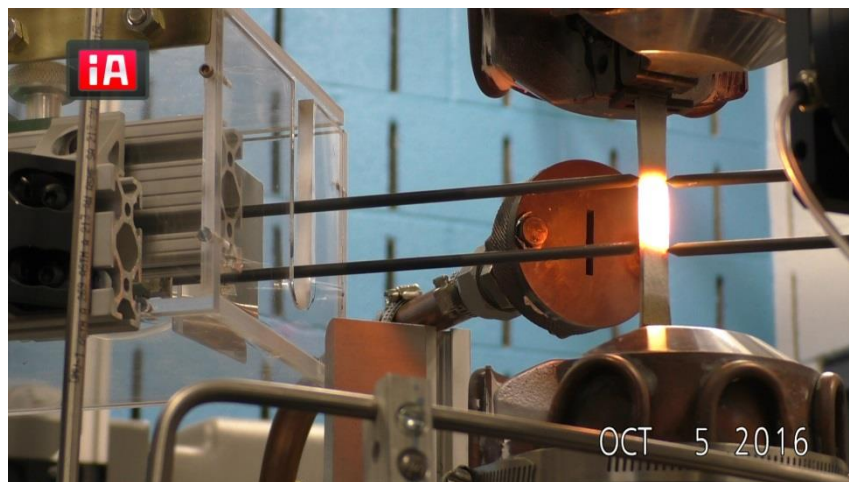

- Servohydraulic , 25 kN Load Cell
- Water-cooled Wedge Grips
- Two 1 in. Gage Length, Water-Cooled Extensometers; 6 in. Long Tensile Specimens
- Frequencies up to 30 Hz
- Load and Stroke Control






Test Issues

- Accurate measurement of through-thickness thermal gradient
 - Pyrometers were used to measure surface temperature
 - Emissivity of the EBC is required to measure temperature with the pyrometer
 - EBC emissivity will change over time
 - Isothermal furnace tests are being done to compare thermocouples and optical pyrometers
- CMC or bond coat temperatures must be estimated from heat transfer
 - The goal was to run isothermal and thermal gradient tests at the same CMC temperature
 - Only the EBC temperature could be monitored during the test
 - The laser power was held approximately constant to maintain constant surface temperature
 - Changes in EBC thermal conductivity over time will affect the CMC temperatures

SPLCF Results under Through-Thickness Thermal Gradient

- EBPVD Coated sample
- Average EBC surface temperature: 2950°F
- Average EBC/CMC interface temperature: 2742°F
- CMC back surface temperature: 2442°F
- Maximum EBC surface temperature: >3000°F

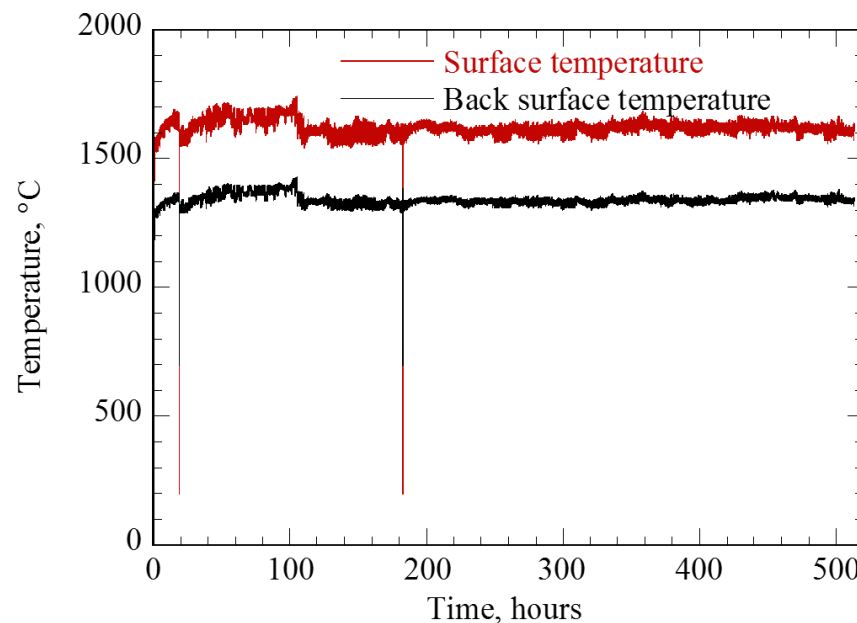
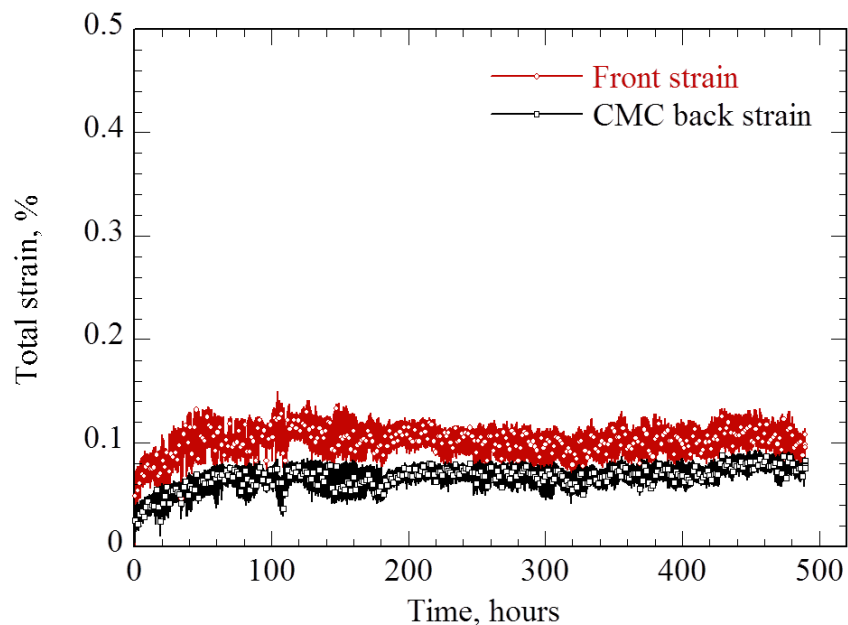
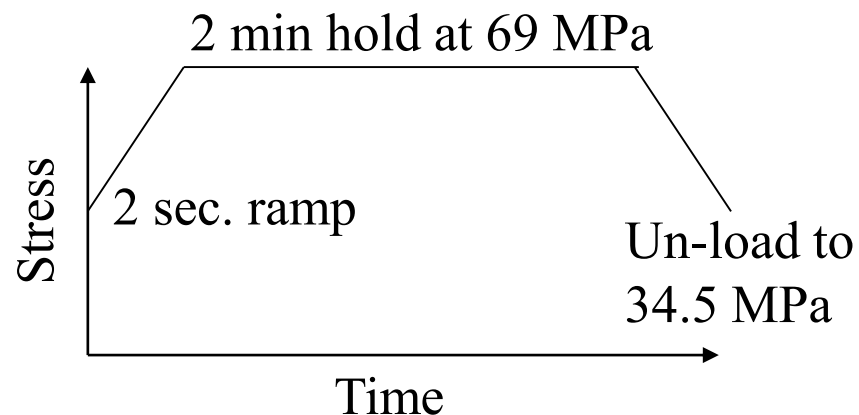




SPLCF Results


Thermal Gradient Compared to Isothermal Conditions

- Both CMC samples were the same system (architecture, matrix, bond coat, EBPVD EBC)
- Both loaded with the same stress profile
- 2700°F isothermal temp is similar to the CMC/EBC interface temp (2742°F) for laser test
- Strain of the isothermal sample is expected to be similar to the front strain of the laser sample

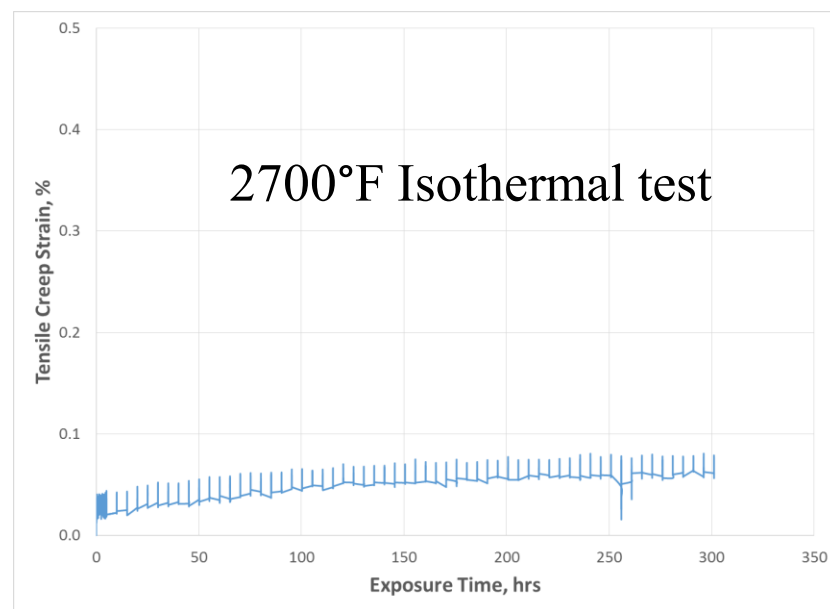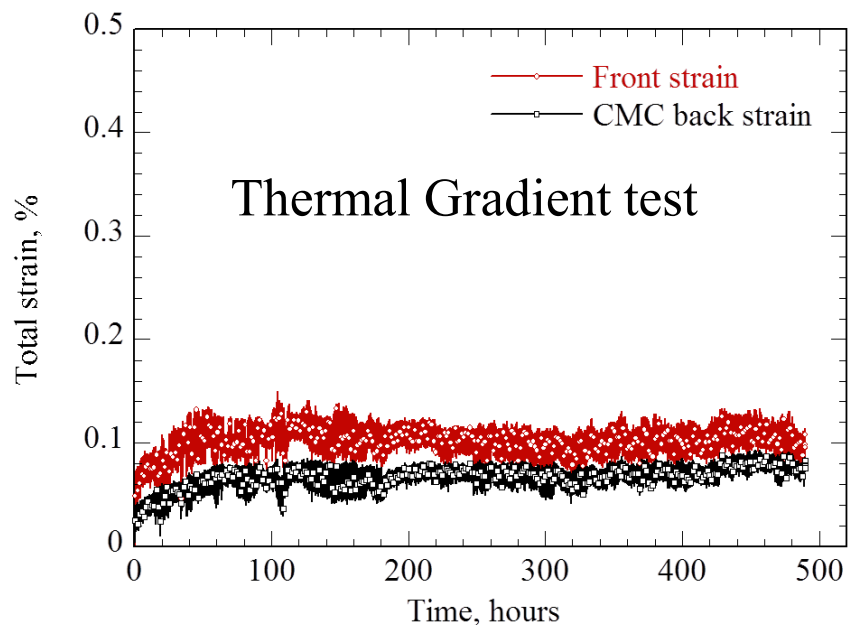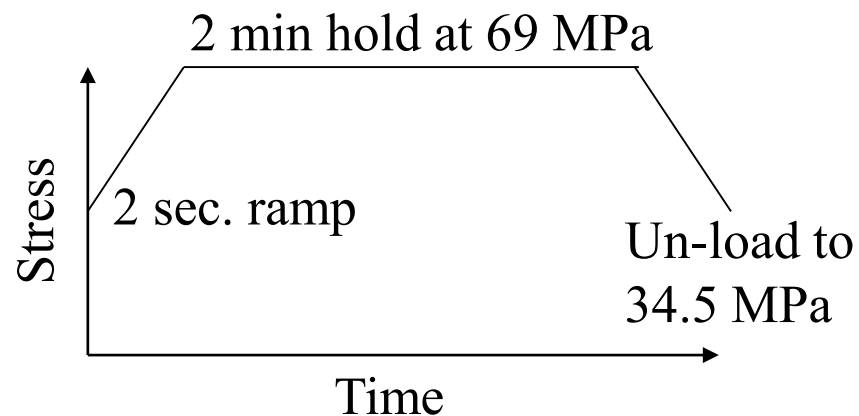




Examination of Sample that Broke During 487 Hour Thermal Gradient SPLCF

- The sample broke outside the hottest region
- The fracture surface was close to the edge of the hot zone (~2200°F)
- The EBC showed pitting/ cracking in the hot zone, below the fracture surface


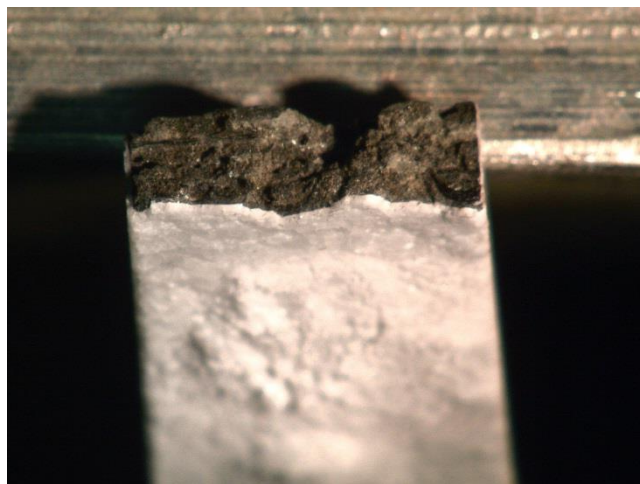


CT Images Before and After Thermal Gradient SPLCF

Before Testing- Only EBC Shown

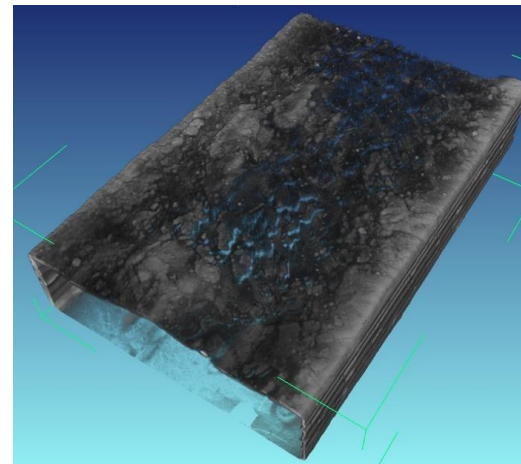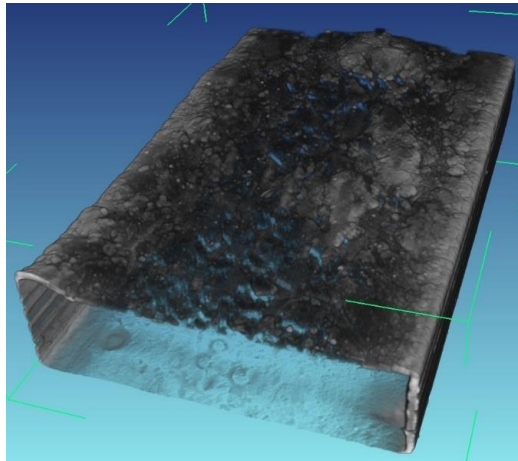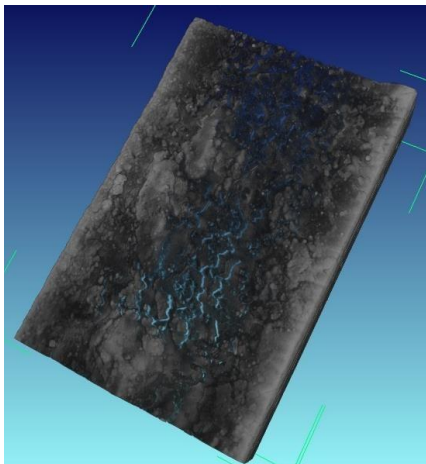




After Laser SPLCF (69 MPa, 487 hr)- Only EBC Shown

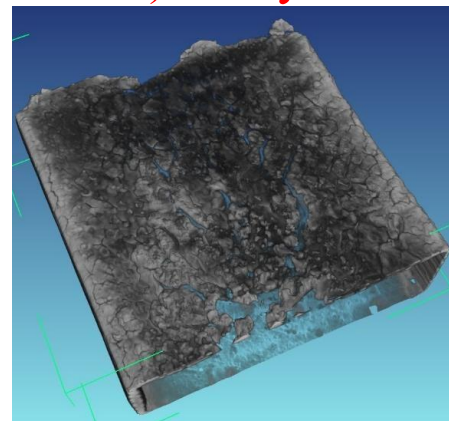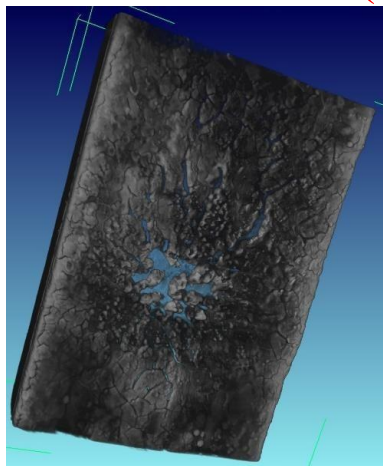

CT Images After Thermal Gradient SPLCF




Fractured End

Image of the EBC Only

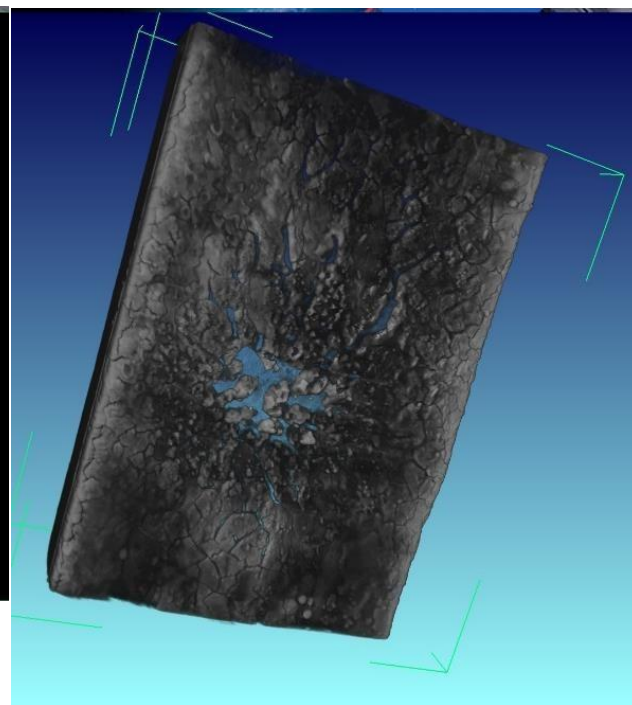
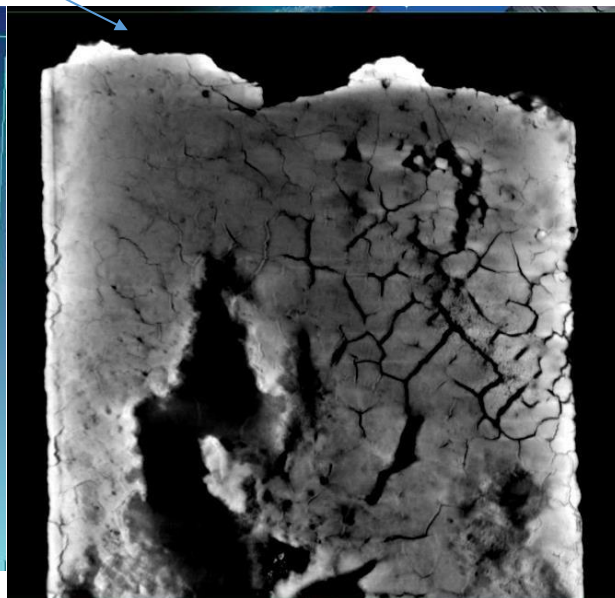
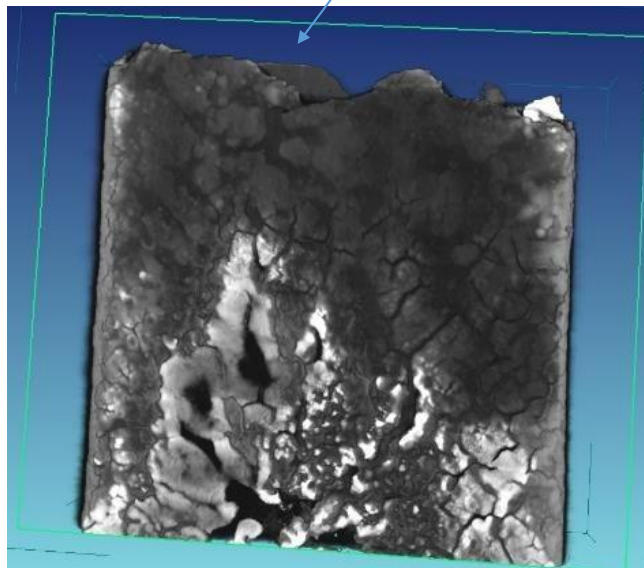


CT Cross-Section Images Before and After Thermal Gradient SPLCF


Before Testing

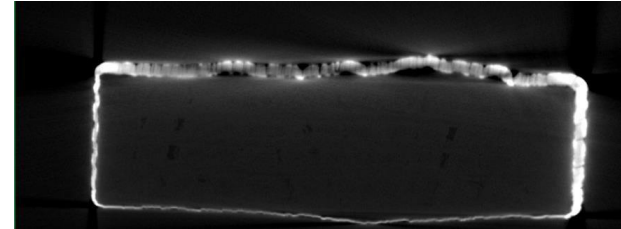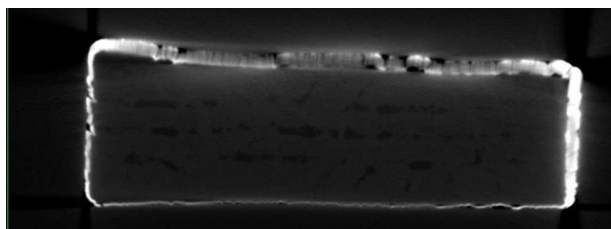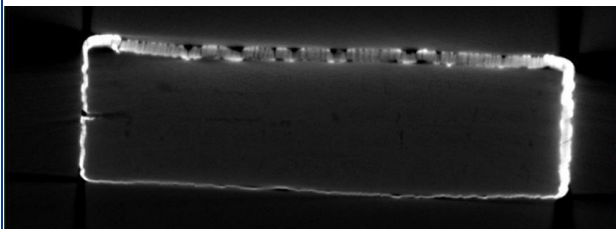

After Laser SPLCF (69 MPa, 487 hr)

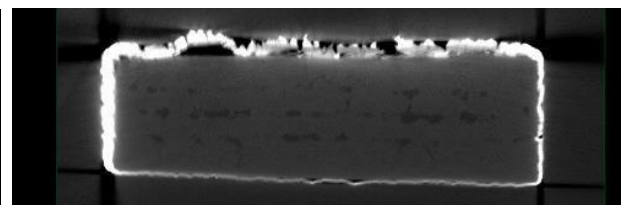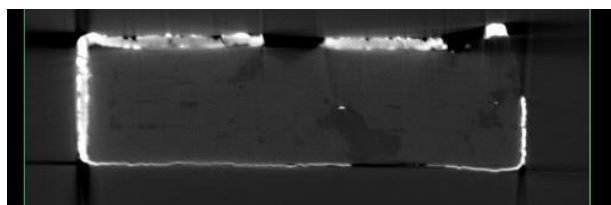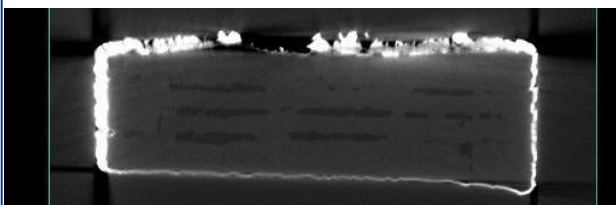


SEM of Fracture Surface after 487 hour Laser SPLCF

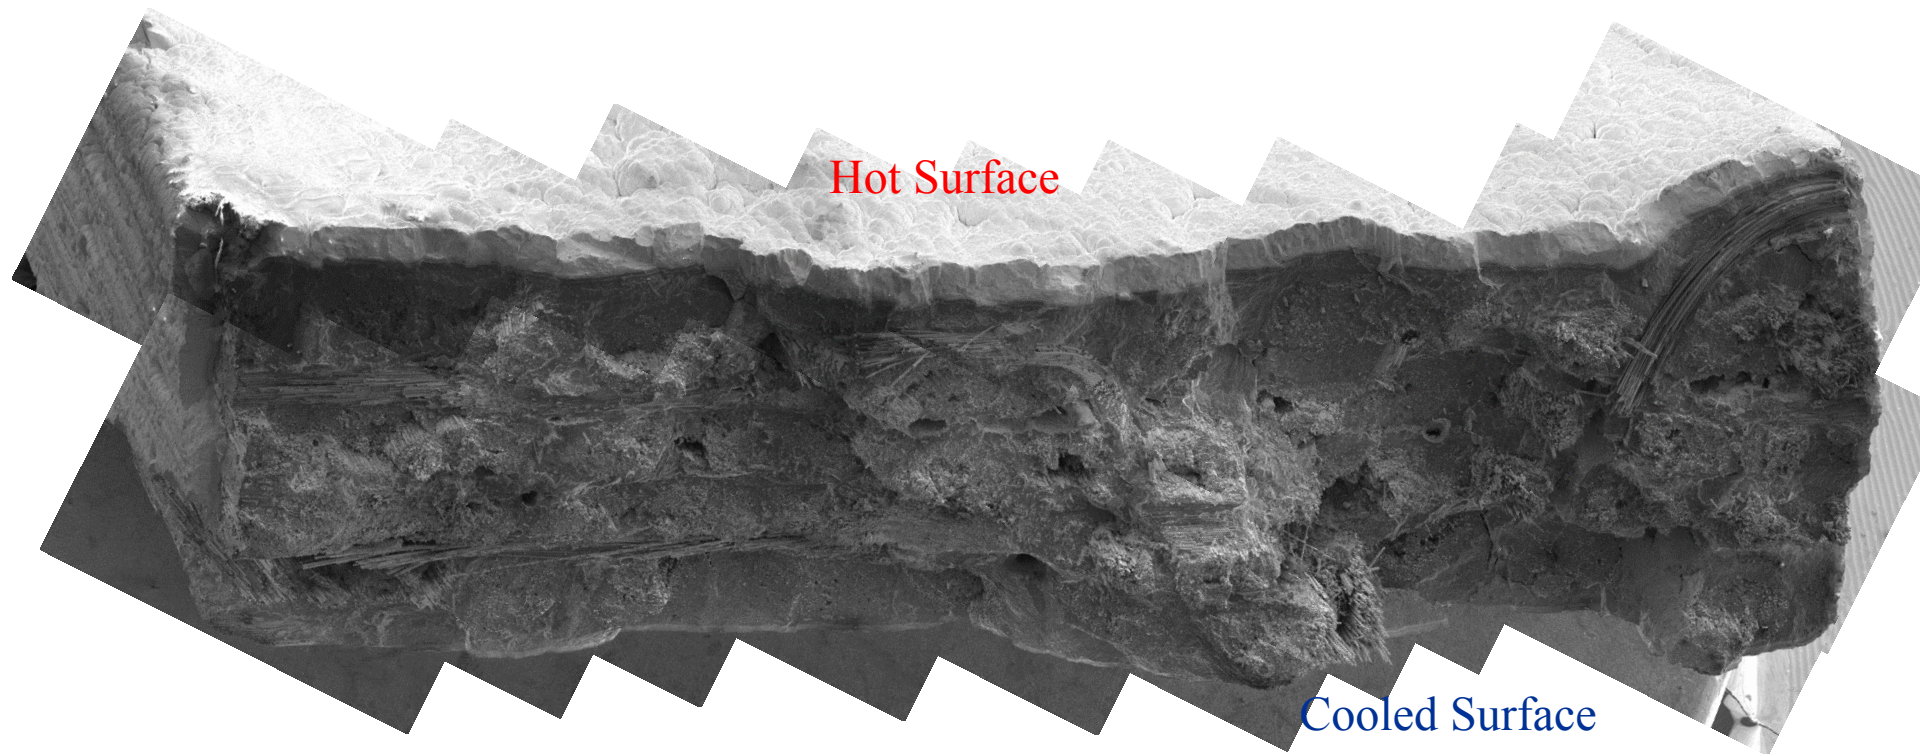


- Very flat fracture surface, little fiber pull-out


SEM of Fracture Surface after 487 hour Laser SPLCF

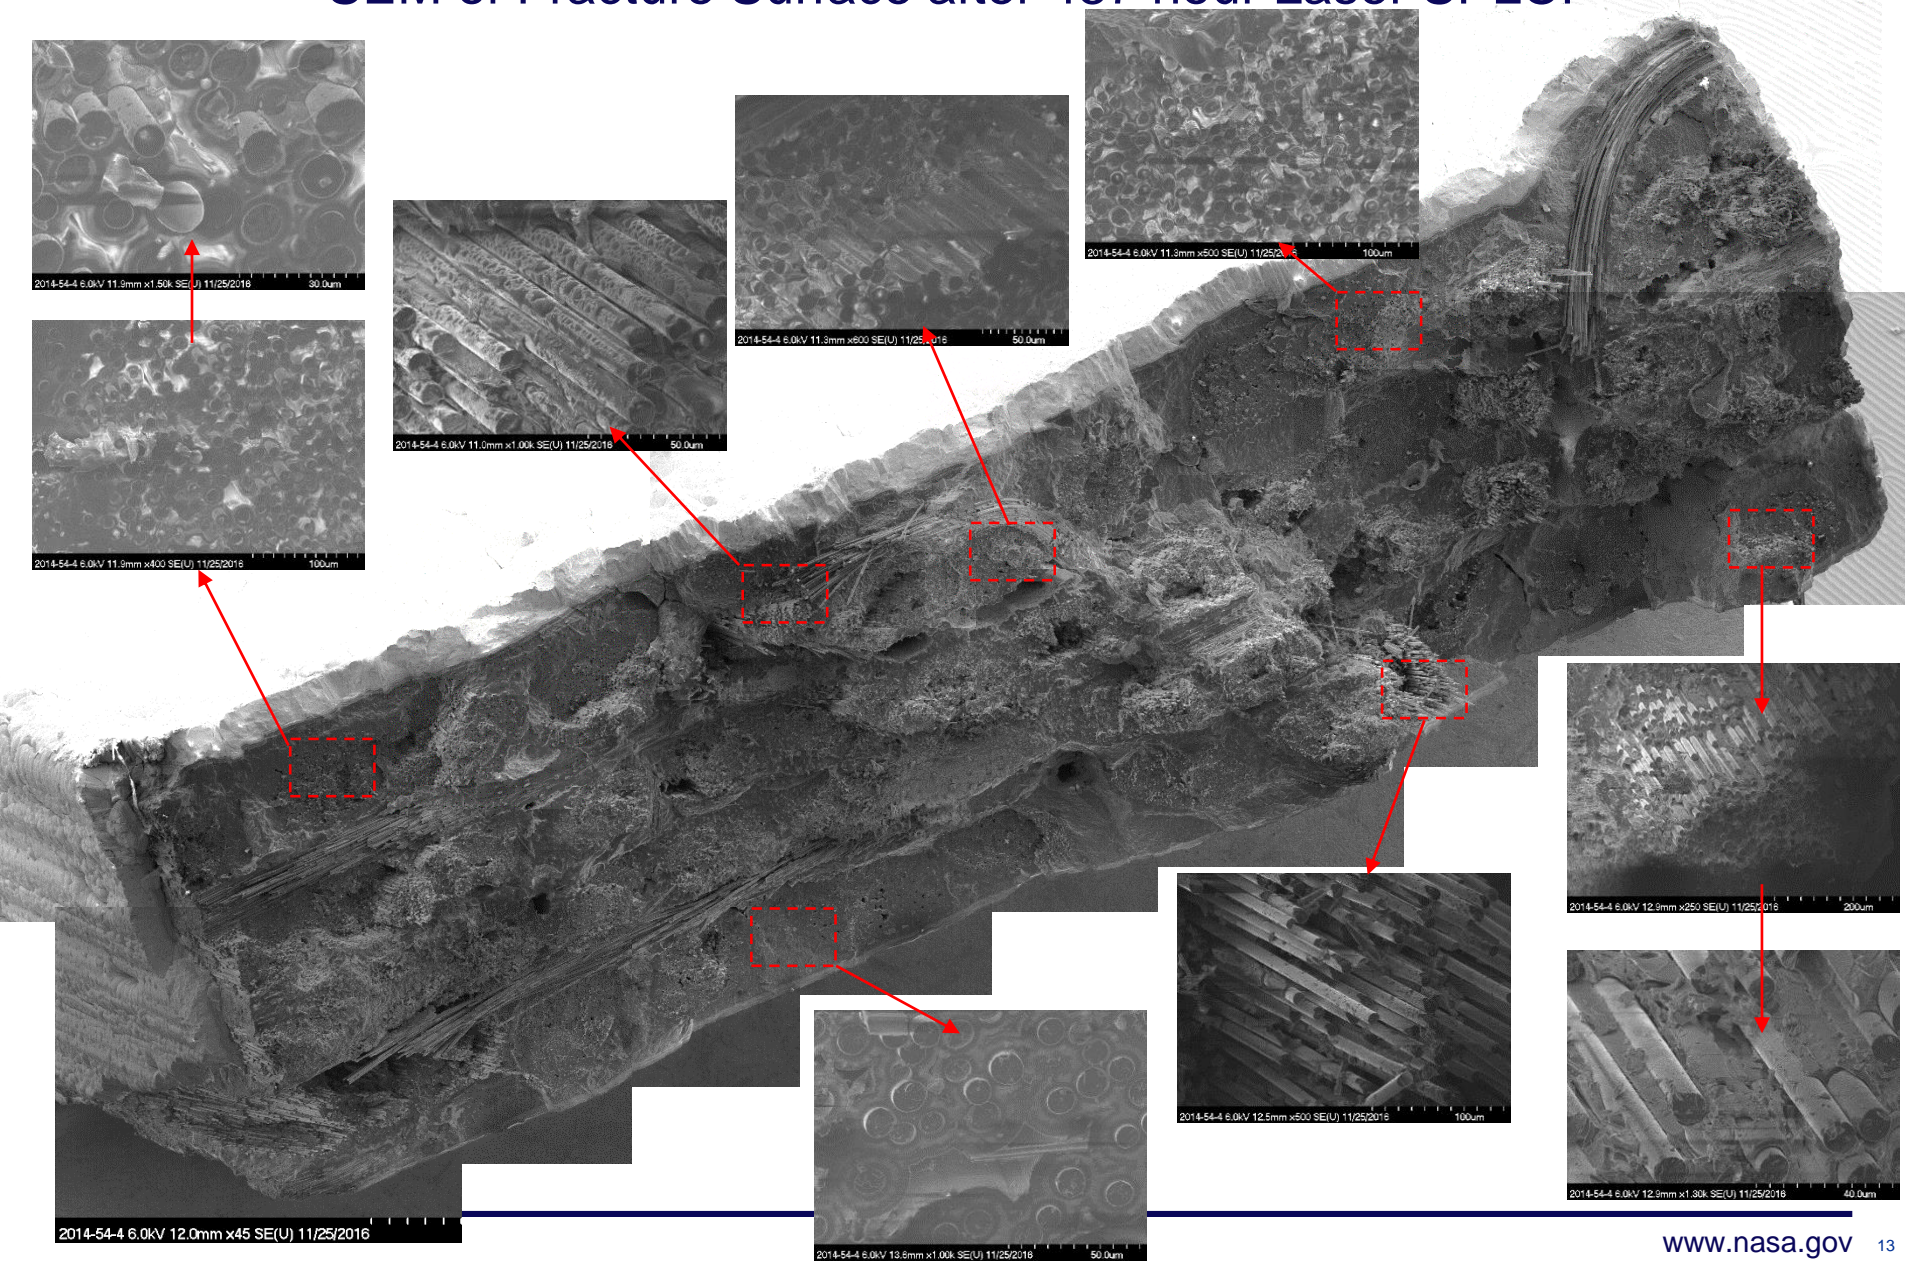

SEM of Fracture Surface after 487 hour Laser SPLCF

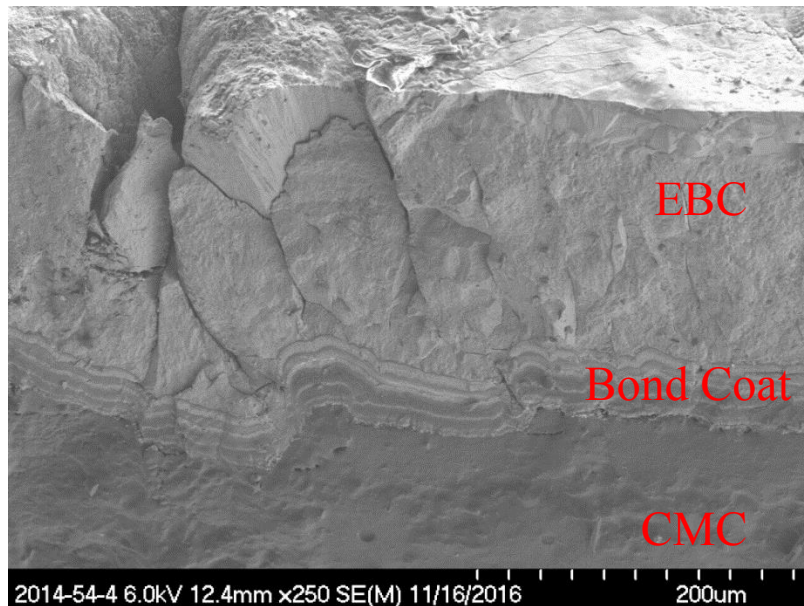

Polished section of the
as-produced system for
comparison

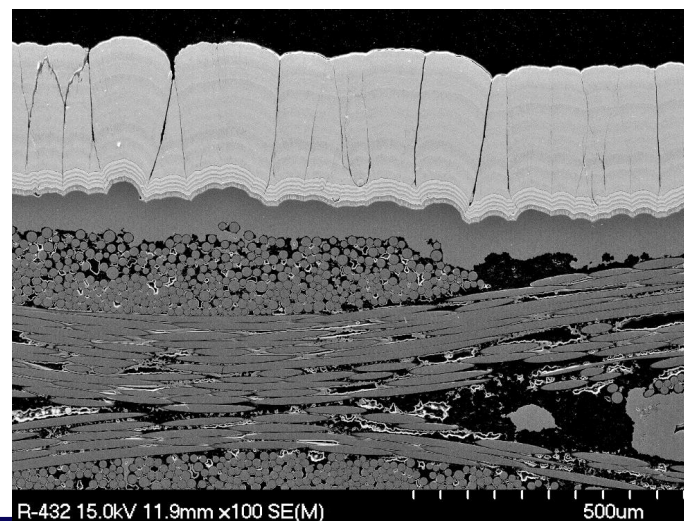


EBC

HfO₂-Si Bond Coat



CMC

SEM of Fracture Surface after 487 hour Laser SPLCF

SEM

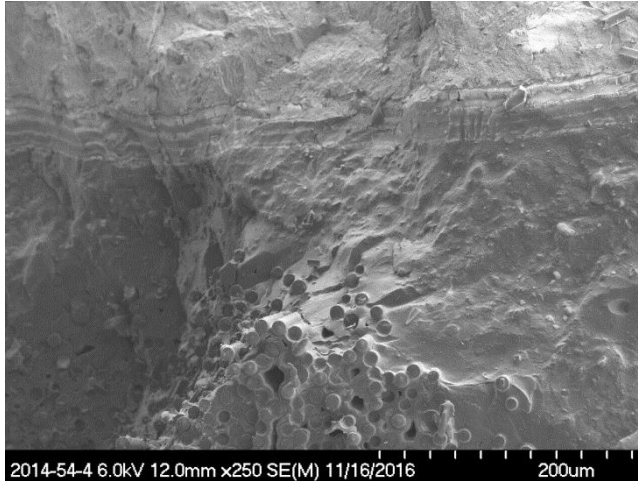

Backscatter

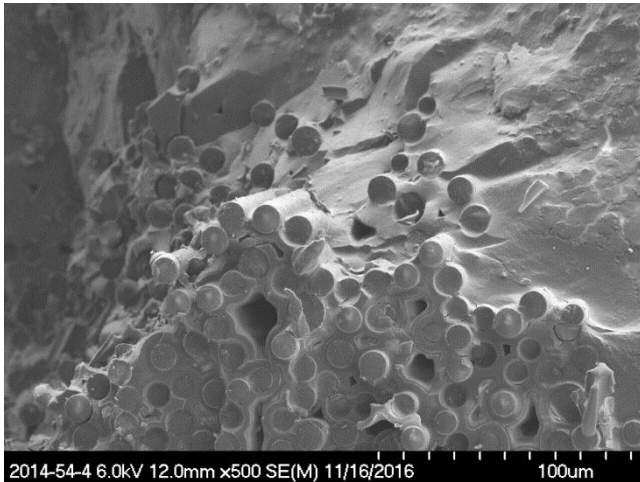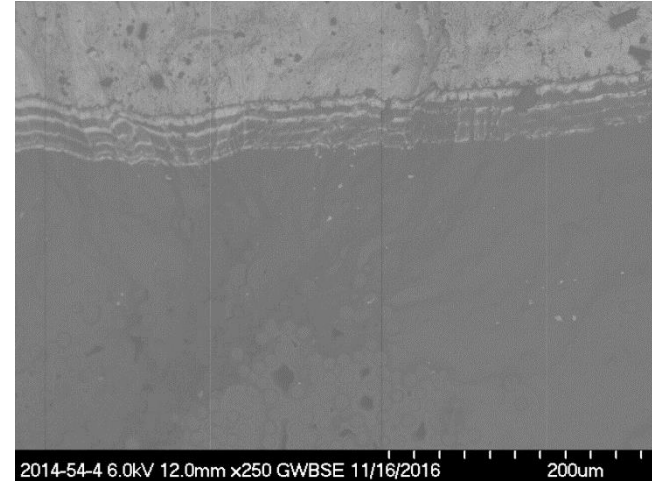

- Most of the fiber tows exhibited brittle failure
- Oxygen mapping of the cross-section was planned, but not yet completed
 - We want to know if the bond coat is oxidizing in air, before moving on to steam
 - Regardless, the sample lasted 487 hours



Conclusions

- Thermal gradient tests are relevant for cooled CMCs
- Interpretation of the data is complicated
- CT images of as-produced sample showed regions of thin coatings
- After the 487 hour SPLCF, some areas of the coating were missing
- The sample may have been overheated beyond 3000F (EBC temperature)
- This sample lasted 487 hours under thermal gradient SPLCF
- More tests are underway to evaluate the material
 - Steam exposure, more thermal gradient tests